

VOLVO

4/7/57

Group 351 No. A6

CLUTCH CONTROL

PV 444

 
Chassis No. 131918
onwards

Service Bulletin.


Only for Volvo Dealers Service Bulletin file.

Re: Rubber bushings in clutch control

The rubber bushings, part no. 655985 for the push rod and part no. 655995 for the intermediary shaft in the clutch control, are now made of harder material. Earlier we introduced a new washer on the push rod, part no. 656823, which is better suited to the shape of the bushing than the earlier washer, part no. 87741. See the illustration.



Part no. 87741

 

Part no. 656823

If difficulty is experienced when declutching, we recommend you to replace the bushings and possibly fit the new model washers. (Only bushings of the new material are now being stocked). After replacement of these parts, the clutch pedal free-play should be adjusted to 10-15 mm ($25/64''$ - $19/32''$).

Volvo will not be compensating for this replacement.