

VOLVO

March 1959

Cars

Group 825 No. A 3

Service Bulletin.

FRONT SEATS

P 1200

PV 444, 445, 544

Only for Volvo Dealers Service Bulletin file.

Re: Seat catches

There have been some complaints that the catches for the front seats do not lock properly.

Examination has shown that during machining, the catches may have received such large radii (see the crossed out figure) that they can slide out of position when loaded.

In cases of complaint the catch should be filed out as shown in the figure. The radii (A) on the catch arm must be maximum 0.04 " (1 mm). The angle (B) between the catch arm and lip should be somewhat less than 90°.

